
Free Angle Vise



ANY TILTING ANGLE

- Special design for quick clamping. (From the acme thread shaft stationly)
- Quick setting by sliding movement. Big clamping capability.
- Operating very quick and easy, can increase so much working efficiency than you can image.
- 360° Rotation, Tilting 30°
- Most free angle vise
- For non-normal angle setting.
- Its swivelling and tilting features with clamping make this unit for straight or inclined surface, angular drilling machining on various machine tools or for bench work table.



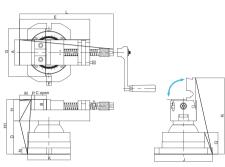









	ORDER NO.	Α	В	C OPEN	D	E	F	G	н	H1	J	K	L	M	N	Р	Q	R	MAX. Clamp Force (kgf)	Weight (kgs)	CODE NO.
l	VAV-3	82	34	85	124	230	17	158	70	194	190	140	374	38	20	12	72	268	700	17.6	1002-214
	VAV-4	106	36	104	134	256	17	158	72	206	190	140	422	38	20	16	72	280	800	21.4	1002-215




Lock-Fixed II Precision Machine Vise

ORDER NO.VMC-4 VMC-6





- With the ability of lock-fixed III 2, 3, 4, 5.
- Use the semi-sphere segment principle.
- When operate several vises (in a row) put on one machine bed, the operating situation is as shown.



Aligned Performance

















	ORDER NO.	Α	В	C OPEN	D	Е	F	G	L	Н	Max. Clamp Force (kgf)	Meas CUFT	Weight (kgs)	CODE NO.
	VMC-4	108	100	110	36	63	283	16	374	202	1500	0.4	14.2	1002-185
ĺ	VMC-6	156	120	142	46	74	370	16	472	221	2500	1.1	29.8	1002-186